

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Primary School, Diu.

Inspected by :Asha Chaudhary, Dy. Director(Social Welfare)/Dy. Chief Electoral Officer, Daman.

Civil works

Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013	Roof tiles broken						—				
	Action not yet taken by concerned dept. on observation to earlier inspection Report	total 5 calsses. 2 classes still left for repair.					3 school in one building only 1 toilet is available.	More storage utensils required.	No		Lacking of drinking water. Borewell water level gone down. R.O. plant available but not working.	
	Observations on the basis of latest inspection	Required RCC framed	Outer building & class rooms need to be whitewash.	Only on ground floor having a ramp for CWSN and middle school is on first floor.	Some of the doors are in good condition, 2 doors reqiored replacement.	1 MDM room window need repair. Window panes are in good condition.	Toilet facility for girls is separate.	MDM is provided on all working days. RCC kitchen. Limited quantity of utensils. MDM is serving properly.	Play ground is not available. Land not available.	Compound wall is there and in good condition.	Storage of water tank is cleaned last year. The tank is placed properly Repair & maintainance R.O. More toilet blocks water supply problem needs to be solved.	

Electric works	CCTV & Smart Class	Infrastructure				Sports Facility	Approach to the schoc Teachers			
No. of Fans/Lights & condition of overall lighting facility	CCTVs & working condition. Function & utilisation of Smart Classrooms. Type of teaching aids/mass media utilised by Teachers.	Availability and Visibility of Black/White Boards in the class rooms.	Availability of Desks/benches/tables & cupboards in the class-room & Staff room. Requirement and Repairables	Status & condition of Science Lab. and availability of equipments & materials.	Status & condition of Computer Room, ACs & computers(installed and in working condition).	Availability of sports facilities, sports room & PE Teacher	Is the school connected with black top road, if not is the approach proper? Is there tobacco selling shop/Bar & Liquor shop within 100 mts of school premises.	No. Of posts & Teachers available. Regular Contractual/Daily wages/ SSA/ Freeship teacher/ Part time. Requirement of specific subject teacher, if any.	Any other relevant observation	General Remarks
14	15	16	17	18	19	20	21	22	23	24
Sufficient fans and lights are available in all the class rooms.			Sufficient Desks and benches are available in all the class rooms							
13 fans in working condition. 2 -3 lights in working condition. Adequate natural lights are also sufficient.	No CCTV installed.	Green boards are available in classes. Yes it is placed in the centre.	10 desks & benches are damage and broken. Frame work have to be done the wooden top is missing.	No science lab.	AC in working condition. 10 computers are installed but only 9 working.	Sport facility not available.	The road is not connected with black top road. No tobacco selling shop and no Bar or liquor shops with school premises.	4 teacher & 1 HM. 4 regular teacher & 1 contractual.	Computer, drawing, English, Science teachers is required. 1 only teacher is there for science & maths.	

II	Name of School : Government Primary School(Bhamti).											
	Data as per Inspection of July, 2013	Roof tiles broken	—	—					—			
	Action not yet taken by concerned dept. on observation to earlier inspection Report	5 class available. 2 classes still left for repair.					3 school in one building only 1 toilet is available.	More storage utensils required.	No			Lacking of drinking water. Borewell water level gone down. R.O. plant available but not working.
	Observations on the basis of latest inspection	Required RCC framed	Outer building & class rooms need to be whitewash.	Only on ground floor having a ramp for CWSN and middle school is on first floor.	Some of the doors are in good condition, 2 doors required replacement.	1 MDM room window need repair. Window panes are in good condition.	Toilet facility for girls is separate.	MDM is provided on all working days. RCC kitchen. Limited quantity of utensils. MDM is serving properly.	Play ground is not available. Land not available.	Compound wall is there and in good condition.	Storage of water tank is cleaned last year. The tank is placed properly Repair & maintainance R.O. More toilet blocks water supply problem needs to be solved.	

				—						
13 fans in working condition. 2 -3 lights in working condition. Adequate natural lights are also sufficient.	No CCTV installed.	Green boards are available in classes. Yes it is placed in the centre.	10 desks & benches are damage and broken. Frame work have to be done the wooden top is missing.	No science lab.	AC in working condition. 10 computers are installed but only 9 working.	Sport facility not available.	The road is not connected with black top road. No tobacco selling shop and no Bar or liquor shops with school premises.	4 teacher & 1 HM. 4 regular teacher & 1 contractual.	Computer, drawing, English, Science teachers is required. 1 only teacher is there for science & maths.	

III	Name of School : Government Primary School,Jampore.											
Data as per Inspection of July, 2013			—	—					—			
Action not yet taken by concerned dept. on observation to earlier inspection Report												
Observations on the basis of latest inspection	Building 2 + 1, Roof- 2 with Mangalore tiles + 1 RCC roof, 3 class rooms + 1 Head Master room	Yes whitewash/ painting is needed	Yes having a ramp for CWSN	No, all the doors are not in good condition. 4 doors need repairs and 4 doors need replacement.	Window panes are not in good condition. 9 windows need repairs	2 toilets are available. Yes toilet are being cleaned regularly. Separate toilet facility for girls are available. CWSN toilet in progress.	Mid-day-meal is being provided, RCC kitchen. Utensils are available. Heas Master room is being used as store room. MDM is being served in clean & hygiene place.	Play ground are not available. No land are available.	Compound wall is there and in good condition.	R.O. plant available but not working. Drinking water is being supplied through tap. Yes cleaning periodically. The storage tank is placed properly.		

							—			
Sufficient fans & lights are available and all in working condition.	—	Yes 6 green boards are available. Yes all boards are placed in the centre.	Desks & benches are not sufficient. 20 more desks & benches are required.	—	—	Sport kits facility available. No sport room are not available.	Yes the road is connected with the black-top. Yes it is proper. No tobacco selling shop and no Bar or liquor shops with school premises.	2 teachers available. 1 regular teacher. 1 under SSA.	Yes teacher is required	

IV.	Name of School : Government Primary School, Patlara.										
Data as per Inspection of July, 2013		—	—	—	—	—	—	—	—	—	—
Action not yet taken by concerned dept. on observation to earlier inspection											
Observations on the basis of latest inspection	1 building with RCC roof. 5 class rooms + 1 Head Master room.	Yes whitewash/ painting is needed	Yes having a ramp for CWSN	No, all the doors are not in good condition. 4 doors need repairs.	Window panes are not in good condition. 5 windows need repairs	3 toilets are available including staff. Yes toilet are being cleaned regularly. Separate girls toilet available. CWSN toilet in progress.	MDM is provided on all working days. RCC kitchen. Yes utensils available. MDM is serving properly.	Play ground are not available. No land are available.	Compound wall is there and in good condition.	2 R.O. plant available. Drinking water is being supplied through tap. Yes cleaning periodically. The storage tank is placed properly.	

—	—	—	—	—	—	—	—			
Sufficient fans & lights are available and all in working condition.	—	Yes 23 white boards and 2 green boards are available. Yes all boards are placed in the centre.	Desks & benches are not available. 20 more desks & benches are required.	—	1 computer are installed for office use and in working condition.	Sport kits facility available.	Yes the road is connected with the black-top. Yes it is proper. No tobacco selling shop and no Bar or liquor shops with school premises.	2 teachers + 1 Head Master. 2 teacher regular, 1 contractual and 1 under SSA.		Yes teacher is required.

V	Name of School : Government High School, Patlara.											
	Data as per Inspection of July, 2013			—				—				
	Action not yet taken by concerned dept. on observation to earlier inspection Report											
	Observations on the basis of latest inspection	1 building with RCC roof. 7 class rooms.	Yes whitewash/ painting is needed	Yes having a ramp for CWSN	No, all the doors are not in good condition. 4 toilet doors need repairs.	Window panes are in good condition	3 toilets are available including staff. Yes toilet are being cleaned regularly. Separate girls toilet available. CWSN toilet in progress.	—	Play ground are not available. No land are available.	Compound wall is there and in good condition.	2 R.O. plant available. Drinking water is being supplied through tap. Yes cleaning periodically. The storage tank is placed properly.	

				—			—			
Sufficient fans & lights available in all the class rooms.	Yes CCTV installed and are in working condition.	Yes Black/white board and 2 green board are available. Yes all boards are placed in the centre.	Desks and benches are available. 20 more benches & desks are required. 5 benches need repair.	Science Lab. Available alongwith equipment.	Computer Lab. Available. AC in working condition. 13 computers are installed all in working condition.	Sport Kits facilities available. Sport room available and also PET teacher available.	Yes the road is connected with the black-top. Yes it is proper. No tobacco selling shop and no Bar or liquor shops with school premises.	10 teacher available. 7 regular teacher + 1 HM, 2 in contractual	1 librarian required.	1 librarian required & benches & desks required.

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Primary School, No.1, Diu.

Inspected by : Arulrajan, IFS, Dy. Conservator of Forest, Daman & Diu.

Civil works

Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
1	Data as per Inspection of July, 2013	1 school building. 4 class rooms	Yes	Yes	Yes, door in good condition	38 windows.	6 toilets. Cleaning weekly and separate toilets for girls is available. CWSN toilet under construction.	Mid-day-meal is being provided, RCC kitchen, place for serving meal Clean. No store room available.	No playground.	Compound wall available	Drinking water available. It is being stored in tank, Tap. R.O. plant available. It is being clean every week. Storage tank is placed properly.	
	Action not yet taken by concerned dept. on observation to earlier inspection Report	01 roof minor repair required. Two more class rooms required.	Two class rooms need white wash.	Yes CWSN Ramp available.	1 door need minor repair.	35 windows need minor repair.	Toilet in good condition minor repair is needed for toilet door.	MDM is being served to all students in 182 days having RCC kitchen.	Yes playground available	Yes	Water is supplied through Tap & PWD tank. There is RO plant available. The Tap/storage tank is placed properly.	Two storage in RCC water tank.
	Observations on the basis of latest inspection							—				

Electric works	CCTV & Smart Class	Infrastructure				Sports Facility	Approach to the schoc	Teachers		
No. of Fans/Lights & condition of overall lighting facility	CCTVs & working condition. Function & utilisation of Smart Classrooms. Type of teaching aids/mass media utilised by Teachers.	Availability and Visibility of Black/White Boards in the class rooms.	Availability of Desks/benches/tables & cupboards in the class-room & Staff room. Requirement and Repairables	Status & condition of Science Lab. and availability of equipments & materials.	Status & condition of Computer Room, ACs & computers(installed and in working condition).	Availability of sports facilities, sports room & PE Teacher	Is the school connected with black top road, if not is the approach proper? Is there tobacco selling shop/Bar & Liquor shop within 100 mts of school premises.	No. Of posts & Teachers available. Regular Contractual/Daily wages/ SSA/ Freeship teacher/ Part time. Requirement of specific subject teacher, if any.	Any other relevant observation	General Remarks
14	15	16	17	18	19	20	21	22	23	24
Sufficient fans and lights are available in all the class rooms. 3 fans and 3 light are not working need repairs.	—	Black board/white boards are existing in all the class room and is fitted in the centre and is in good condition.	Sufficient Desks and benches are available in all the class rooms	—		Sport facility is available. No sport room and no teacher available	NO	4 teacher available. 3 regular and 1 under SSA. 1 more teacher required		
3 fans and 3 light are not working need repairs.		Black board/white boards are existing in all the class room and is fitted in the centre and is in good condition.			Required 1 computer for office work and students study.	Sport facility is available. No sport room and no teacher available	—	4 teacher available. 3 regular and 1 under SSA. 1 more teacher required		
							—			1. One computer & fax & Printer. 2) Separte school building. 3) Food time has to be changed. 4) Vaccination programme 1 + 1 Health check up.. 5) One telephone connection for emerency.

II	Name of School : Government Primary School, No.2, Diu.										
Data as per Inspection of July, 2013	1 building and 2 class rooms	Yes	Yes	All the doors are not in good condition.	All the window are not good condition.	6 toilets available. Cleaning every week. There is separate toilet for girls. CWSN toilet under construction	Mid-day-meal is being provided, RCC kitchen, place for serving meal Clean. No store room available.	No	Yes, the school is having compound wall.	Drinking water is supplied through tap. RO plant is available. Storage tank is placed properly.	
Action not yet taken by concerned dept. on observation to earlier inspection Report	1 roof need minor repair. Two more class rooms required.	3 class room need whitewash	CWSN ramp available	2 doors need repair	There are 35 windows. 3 windows in good condition and 32 windows minor repair.	Toilet doors need minor repair	MDM is being served to all students in 182 days having RCC kitchen.	Yes playground available		The water is being supplied by PWD tank. The storage tank is being cleaning every week.	Two storage in RCC water tank.
Observations on the basis of latest inspection											

Sufficient fans & lights are available in all the class rooms.	—	There are sufficient black board all fitted in the centre and in good condition. 1 black board is not fitted in the centre.	Sufficient Desk and benches are available in all the class rooms. 3 benches are broken.	—		Sport facility is available. No sport room and no teacher available	No	4 teacher available. 4 regular teacher. Two more teachers required		
2 fans and 1 light is not working					Required 1 computer for office work and students study.					
								Food for pre-primary children has to be provided cooked food. Sanitation is required in all stages /Class grades of students in class rooms. Play toys to be provided.	Re-building(old) of school is necessary. Kitchen, ground, 1 class room + 1 teacher required. Library.	

III	Name of School : Government Middle School(Boys), Diu.											
	Data as per Inspection of July, 2013	Renovation work was under progresss	Ground floor and outside of building not white wash.	Yes	No	No	2 toilets are available & function. Toilet found clean. Separate toilet for girls available. CWSN toiles available.	MDM is being served. RCC kitchen, Utensils available, Store room in good condition, Place for serving MDM clean and hygiene..	No	Compound wall available	Drinking water is supplied through tap. RO plant is available. Water tank is being cleaned twice a year. Storage tank is placed properly.	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	Work has been completed			One door need repair	6 window panes are broken, 4 need repair, 3 windows need replacement					Borewell with pump is required to meet the need of water. Termite proofing water terrace proofing.	
	Observations on the basis of latest inspection	83 students(3 rooms)				All windows require to be replaced	No lights available in toilets					

IV.	Name of School : Government Middle School,(Girls), Diu.											
	Data as per Inspection of July, 2013	Renovation work was under progress		yes		No	2 toilets are available & function. Toilet found clean. Separate toilet for girls available. CWSN toiles available.	MDM is being served. RCC kitchen, Utensils available, Store room in good condition, Place for serving MDM clean and hygiene..	No Play ground	There is compound wall	Drinking water is supplied through tap. RO plant is available. Water tank is being cleaned twice a year. Storage tank is placed properly.	—
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	Work has been completed	Out side of the building and ground floor not white wash.		Two doors need repair	Fifteen panes are broken. 4 windows need repair. 08 windows need replacement					Borewell with pump is required to meet the need of water. Termite proofing water terrace	
	Observations on the basis of latest inspection					All 67 windows are replaced.	No lights available in toilets	—				

Sufficient fans and lights are available in all the class rooms. 18 fans and 26 lights are in working condition.	—	Yes sufficient Black/white board available	Sufficient desks and benches are available all in good condition.	Science lab. Available.	Computer lab. Existing with 15 computers. 13 computers in working condition.	Sport facilities available with sport room and PET teacher.	Yes, the school road is connected with black top road. No tobacco selling shop and no Bar or Liquor shop near school premises.	7 teacher available. 5 regular teachers. 01 contractual and 1 Under SSA. Science and maths teacher required.		1) CWSN placement is improper. 2)(H2O) water outlet channels to be provided. 3) All windows to be replaced. 4)Two more burner for good cooking needed. 5) flooring has to be repaired. 6) No. of classroom should be more (currently 3
5 fans need repair and 16 lights need repair/replacement.			2 iron cupborad (MDM) broken			New more sports goods required.				rooms for 135 girls students). 7) More sports goods to be provided. 8)New play ground. 9) Toilets for staffs to be provided. 10)
										Utensils for cooking food has to be removed. 11) T.V. has to be provided. 12) Roof top touching has to be done to arrest separate in computer room. 13) Firest aid bos in each class room & fire existngure has to be placed & taught to students to operate. 14) Separate school campus is hardly required. 15) School sport groun d has to be provided. 16)Emergency exist for whole school. 17)Annual scheme of operation has to be provided by the H.M. of school. 18) Mid Day Meal scheme to be on operation then in paper.

V	Name of School : Government Primary School,Gandhipara, Diu.											
	Data as per Inspection of July, 2013	School building, roof and class are ok	—	Yes, CWSn ramp available.	All the doors are not in good condition.	All the window are not in good condition. They are repairable.	Toilet available. Regularly cleaning, separate toilet for girls available. CWSN toilet available	MDM is being served. RCC kitchen, Utensils available, Store room in good condition, Place for serving MDM clean and hygiene..	No playground available.	Compound wall available.	Drinking water is being supplied through Tap. R.O. plant available. Cleaning of the water tank is being done once a month. Storage tank placed	Require block pave at front of the school compound.
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	2 class room need major rep	All the class room need white wash.			17 windows are in good condition. 2 windows are repairable	Toilet is being cleaning daily	MDM is being supplied in 182 day			Drinking water is being supplied through PWD tank, Diu. The water tank is being cleaing every week.	
	Observations on the basis of latest inspection											

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Higher Secondary School, Diu.

Inspected by :Debendra Dalai, Conservator of Forest, DD&DNH.

Civil works

Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013	Pucca building with RCC roof, flooring with glazed tiles, some window pane damaged otherwise intact. Class rooms Spacious, well ventilated	06 nos class room require painting	—		Some windows damaged otherwise intact.	Toilets functional	—	Available with good basket ball court. Very impressive.	NO	Drinking water available alongwith water cooler. Bigger filter required. Storage tank is placed properly.	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report											
	Observations on the basis of latest inspection	Roofing for 10 class rooms being re-done with RCC demoliting the existing ones. One new hall constructed for the college purpose.	White washing and painting has been done.		—			—				

Electric works	CCTV & Smart Class	Infrastructure				Sports Facility	Approach to the schoc Teachers			
No. of Fans/Lights & condition of overall lighting facility	CCTVs & working condition. Function & utilisation of Smart Classrooms. Type of teaching aids/mass media utilised by Teachers.	Availability and Visibility of Black/White Boards in the class rooms.	Availability of Desks/benches/tables & cupboards in the class-room & Staff room. Requirement and Repairables	Status & condition of Science Lab. and availability of equipments & materials.	Status & condition of Computer Room, ACs & computers(installed and in working condition).	Availability of sports facilities, sports room & PE Teacher	Is the school connected with black top road, if not is the approach proper? Is there tobacco selling shop/Bar & Liquor shop within 100 mts of school premises.	No. Of posts & Teachers available. Regular Contractual/Daily wages/ SSA/ Freeship teacher/ Part time. Requirement of specific subject teacher, if any.	Any other relevant observation	General Remarks
14	15	16	17	18	19	20	21	22	23	24
Sufficient fans and lights are available in all the class rooms.		Black board/white boards are existing in all the class room and is fitted in the centre and is in good condition.	Sufficient Desks and benches are available in all the class rooms	Science Lab. Available and in good condition	Computer lab. Very impressive with 21 computers	Sport facility is available but only T.T. room.	—	16 teachers available		
	CCTV is required for better safety and security of the students.						—			School is well maintained. The playground is partly concrete/pavers, which should have been avoided. More greenery is required to be created in the campus.

II	Name of School : Government High School(girls), Ghogla, Diu.											
	Data as per Inspection of July, 2013	Pucca building with RCC roof and tiled floor. Class room spacious	—	—	All the doors are not in good condition.	All the window are in good condition	Toilets functional, separate toilet for girls are available.	—	Play ground is available.	Yes, the school is having compound wall.	Drinking water is supplied through tap. RO plant is available. Storage tank is placed properly.	
	Action not yet taken by concerned dept. on observation to earlier inspection Report											
	Observations on the basis of latest inspection	6 new rooms are under construction					Functional, Separate toilet for boys and girls required on the first floor.				Available. However, drinking water along with water cooler and RO system required on the first floor.	

Sufficient fans & lights are available in all the class rooms.		There are sufficient black board all fitted in the centre and in good condition.	Sufficient Desk and benches are available in all the class rooms	—	Computer lab. Available with 9 computer. 5 more are required. 5 computers are installed and 9 computers are in working condition.	Sport facility is available. No provisions for indoor games		12 teachers are available. 11 regular & 1 contractual.		
					10 more computers required	Provisions for indoor games is required to be made.		All the vacancies of teaching staff have been filled on contract basis. Vacancy - 8, subject-wise teacher required.		The school is well kept, the infrastructures are well maintained. More greenery is required to be maintained in the campus.

III	Name of School : Government High Secondary School, Bucharwada, Diu.											
	Data as per Inspection of July, 2013	Double storeyed, pucca building, Doors and windows intact, recently painted. Spacious , tidy, well ventilated.	—	—	Doors intact	Window intact	Toilet functional. Separate toilet for girls available.	—	Excellent with compound wall	Compound wall available	Drinking water available alongwith water filter but no cooler. Water is being supplied through Tap & borewell. R.O. Plant available. Storage tank placed properly.	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report											
	Observations on the basis of latest inspection	4 new classrooms are under construction.					Functional. Two more toilets are required to be constructed on the first floor which is not there right now. Existing toilets are being maintained well.				Bigger R.O. is required to cater to the requirement.	

Sufficient fans & lights are available		White board in a very good condition.	Good number of desks & benches and in good condition.	Well equipped.	Good computer lab with 11 computers. 10 more are required to meet the demand and can be accommodated in the available space. All 11 computers in working condition.	Foot ball, Volley ball, Badminton and cricket kit is available.	—	10 teachers available. 8 vacancy.		
The classrooms are well lit and well ventilated.	CCTV is required for better safety and security of the students.				10 more computers are required.			11 teachers filled on contract basis.		The school has an excellent infrastructural facilities with spacious and well ventilated classrooms, compound is well kept. Too much of concreting in the compound should be avoided. More greenery is required to be created in the campus.

IV.	Name of School : Government Middle School, Bucharwada, Diu.											
	Data as per Inspection of July, 2013	The school building is under major repair and hence has been abandoned and functioning from the Government Higher Secondary School, Bucharwada. The abandon building is in very bad shape, necessary action has been initiated by the Panchayat to repair and renovate the same. The roof of the building is unsafe and hence to be dismantled. New toilets needs to be constructed. Plastering for the entire building needs to be done since there are many cracks seen on the wall. New doors and windows needs to be fitted alongwith complete re-wiring and electrification.	—	—	—	—	—	—	No Play ground	There is compound wall	—	—
	Action not yet taken by concerned dept. on obervation to earlier inspection											
	Observations on the basis of latest inspection	The existing old building is being demolished and school is running from the Higher Secondary School.	—	—				—				

—	—	—	—	—	—	—	—	7 teacher available. Vacancy of 2 teachers		
								The vacancy of two teachers filled on contract basis and two subject specific vacancy still remainig.		The school building is under major repair and hence being demolished for construction of new building.

V	Name of School : Government Higher Secondary School(Girls), Vanakbara, Diu.											
	Data as per Inspection of July, 2013	Building is pucca, window pane partly damaged, RCC roofing with tiled flooring. Class rooms spacious.		—	Door intact	Windows intact.	Insufficient and not well maintained. New toilets required to be constructed. Not well maintained.	—	No playground, nearby pachayat play ground being used by the students.	Compound wall available.	Drinking water available but bigger water filter of capacity 200-250 liters required. Water supplied through Tap & borewell. Storage tank placed properly.	
	Action not yet taken by concerned dept. on observation to earlier inspection Report								No playground, nearby pachayat play ground being used by the students.			
	Observations on the basis of latest inspection	New construction of school building for Higher Secondary started. Plastering has been done wherever required.	Painting and white washing, both interior and exterior has been done for the entire building.				New toilets constructed alongwith safety tank and with running water facility. Existing toilets being maintained well.			Collapseable gate required for better safety.		

Sufficient fans & lights available in all the class rooms.		Sufficient black/white board available and in good condition.	In-Sufficient desk and benches are available. 150 more desk/benches required.	—	In good condition with 10 computers. 10 more are required. All 10 computers in working condition.	Volleyball, cricket and Badminton available.	—	11 teachers available. 18 teachers required more.		
					Additional requirement of 10 more computers have not been met.					
Adequate fans and lights are available. Two fans need repair and five tube lights need repair.	CCTV is required for better safety and security of the students.		Additional requirement of desk/bench not yet met		10 additional computers required					The school has got an impressive infrastructure and is well kept. More greenery is required to be created in the campus.

Electric works	CCTV & Smart Class	Infrastructure				Sports Facility	Approach to the schoc Teachers			
No. of Fans/Lights & condition of overall lighting facility	CCTVs & working condition. Function & utilisation of Smart Classrooms. Type of teaching aids/mass media utilised by Teachers.	Availability and Visibility of Black/White Boards in the class rooms.	Availability of Desks/benches/tables & cupboards in the class-room & Staff room. Requirement and Repairables	Status & condition of Science Lab. and availability of equipments & materials.	Status & condition of Computer Room, ACS & computers(installed and in working condition).	Availability of sports facilities, sports room & PE Teacher	Is the school connected with black top road, if not is the approach proper? Is there tobacco selling shop/Bar & Liquor shop within 100 mts of school premises.	No. Of posts & Teachers available. Regular Contractual/Daily wages/ SSA/ Freeship teacher/ Part time. Requirement of specific subject teacher, if any.	Any other relevant observation	General Remarks
14	15	16	17	18	19	20	21	22	23	24
								H.M. + 4 regular teacher & 1 under SSA	Shifted to GPS - 2 (Ghoghla) & functioning in the morning session.	Re-inspected & photographed fit for total demolition & reconstruction.
								H.M. + 3 regular teacher		
								1 H.M. + 4 regular teacher	Shifted to boys (GHS) Ghoghla (afternoon session)	School building vacated on 19/9/2013. Re-visited on 1/3/2014 fit to be demolished.

									1 H.M. 4 regular teacher , 1 under SSA.		
									1 H.M. 4 regular teacher , 1 under SSA.	Kaburh X 2 (Majhora) to be shifted out to facilitate playground infront.	Total demolition & reconstruction reconnended revisited & informed.
									H.M. + 2 , 2 Daily wages, 3 under SSA teacher		
									H.M. + 2 , 2 Daily wages, 3 under SSA teacher	Fit for demolition & reconstruction	Recommended as above.

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government High School,Kachigam Nani Daman.

Inspected by : S.S. Sidhu, Chief Executive Officer, District Panchayat, Daman.

Civil works

Sr .No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hyginic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013	2 buildings, RCC roof, 3 class rooms	Not required	Yes	All door in good condition	Good	Yes		Playground available But paver blocks	Compound wall available	Yes	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report								Paver block not removed			
	Observations on the basis of latest inspection	2 buildings, RCC roof, 3 class rooms + 7 other rooms = 10 class rooms	Not required	Yes	All door in good condition	Good	1 toilet for boys and one toilet for girls. Clean toilet. Work in progress for constructionof CWSN toilet.		Yes, paver block not removed.	Yes there is compound wall fancing required.	Water is supplied through Tap. There is RO plant available. The Tap/storage tank is ok. Cleaning O.K.	

Electric works	CCTV & Smart Class	Infrastructure				Sports Facility	Approach to the schools	Teachers		
No. of Fans/Lights & condition of overall lighting facility	CCTVs & working condition. Function & utilisation of Smart Classrooms. Type of teaching aids/mass media utilised by Teachers.	Availability and Visibility of Black/White Boards in the class rooms.	Availability of Desks/benches/tables & cupboards in the class-room & Staff room. Requirement and Repairables	Status & condition of Science Lab. and availability of equipments & materials.	Status & condition of Computer Room, ACs & computers(installed and in working condition).	Availability of sports facilities, sports room & PE Teacher	Is the school connected with black top road, if not is the approach proper? Is there tobacco selling shop/Bar & Liquor shop within 100 mts of school premises.	No. Of posts & Teachers available. Regular Contractual/Daily wages/ SSA/ Freeship teacher/ Part time. Requirement of specific subject teacher, if any.	Any other relevant observation	General Remarks
14	15	16	17	18	19	20	21	22	23	24
Adequate fans and lights are available in all the class rooms. But repair is needed	Yes CCTV installed	Sufficient black/white board is available all fitted in the centre.	There are sufficient desk & benches. All in good condition.	Science lab. Available but under repair	Computer lab in good condition with AC and 17 computers in good and working condition .	Yes, sport facility is available. Separate room for sport equipment. There is PET Teacher.		5 teacher available		
Done				Repairing done but need platform & sink						
All Fans & lights working in new building for GHS but Electrification repairing to be done for GMS building	Yes CCTV installed	Sufficient black/white board is available all fitted in the centre.	There are sufficient desk & benches. All in good condition. Extra to be exposed.	Require platform & sink.	Computer lab in good condition with AC and 17 computers in good and working condition .	Yes, sport facility is available. Separate room for sport equipment. There is PET Teacher 3 days a week.	Yes, the school road is connected with black top road. The road is OK	7 teacher, 7 regular & 1 part time. One teacher for English subject is required.		Tiles repairing in CR. Building repairing. Electrification overall repairing. Total wiring needed. Subject teacher required.

II	Name of School : Government Middle School, Damanwada, Nani Daman.											
	Data as per Inspection of July, 2013	2 school buildings. RCC frame. 3 class room in good condition.	White wash not required.		Doors found satisfactory but some need repair	Repairing to be done	1 boys toilet and 1 girls toilet available. Toilet not in good condition	Good MDM is being provided. RCC kitchen. Store room & Utensils are available. Place for serving MDM cleaned & hygiene.	Sufficient play ground	Compound wall available	Water is supplied through Tap. There is RO plant available. The Tap/storage tank is ok. Cleaning O.K.	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	4 additional class room required. The estimate for 2 addl. Room is prepared by Dist. Panchayat and for remaining 2 class the JE of PWD has been directed to take necessary action.				Some windows yet to be repaired by PWD	PWD, Daman for repairing of one toilet block		The PWD was directed to remove the steps in front of the stage but till now it has not been removed. The JE has been directed to get this work done immediately so that more space will be available for play			
	Observations on the basis of latest inspection	2 school buildings. RCC frame. 2 class room (for library, Computer & H.M).		yes	Doors found satisfactory but some need repair	Some windows yet to be repaired by PWD	1 boys toilet and 1 girls toilet available. Toilet not in good condition and separate girls toilet available. One toilet repairable.CWSN toilet in progress	Good MDM is being provided. RCC kitchen. Store room & Utensils are available. Place for serving MDM cleaned & hygiene.	Action to be take by the PWD	Compound wall available	Water is supplied through Tap. There is RO plant available. The Tap/storage tank is ok. Cleaning O.K.	

Adequate fans & lights are available in all the class rooms but one fan and 1 tube light need repair.	No CCTV installed	Sufficient Black/white board available all in the centre	There are sufficient desk & benches in all the class room average quality but teacher table & chair in bad condition.	Equipment available but no room	Computer lab. Yes. AC not working. 10 computers installed all in working condition.	Sport facility available but no sport room. There is PET teacher.		4 teacher. 1 Additional teacher required		
				Estimate prepared & put further for action		Estimate prepared and in progress.				
Adequate fans & lights are available in all the class rooms but one fan and 1 tube light need repair.		Green board fitted in the centre	There are sufficient desk & benches.	Equipment available but no lab. Room. Action to be taken	Computer lab. Yes. AC not working. 10 computers installed all in working condition.	Yes, sport facility is available. No separate sport room. There is PET Teacher 3 days a week.	Yes, the school road is connected with black top road. The road is OK	1 H.M., 1 contractual teacher and 1 teacher under SSA. Addl. Teacher not required.		Additional 4 class room required. Separate staff room, laboratory, library. Toilet block need repair. During the inspection it was told by children that one boil egg three days a week us being served to them most of the children take egg and they like it very much. A fe children who do not take egg are being provided banana additionally.

III.	Name of School : Government Primary School, Damanwada.												
	Data as per Inspection of July, 2013	2 school building, Roof RCC structure, 2 class rooms in good condition			Yes good condition.	Yes good condition	2 toilets but 1 repairable,the toilet not ingood condition. Cleaning every day. Separate toilet for girls available.	Mid-day-meal is being provided, RCC kitchen good condition, store room OK. Place for serving meal OK.	No playground	Yes there is compound wall and in good condition.	Drinking water being supplied through tank. R.O. Plant available. Tap point required.		
	Action not yet taken by concerned dept. on obervation to earlier inspection Report								No land in sufficient		R.O. not installed.		
	Observations on the basis of latest inspection	1 school building, RCC roof structure. 4 class room + 1 office required. Estimate for 2 addl. Class room has been prepared by Dist. Panchayat. The J.E. of D.P. and PWD have been directed to check the feasibility of the existing BRC building for construction of 2 addl. class room.	Yes (old building)	Yes	Good condition	Good condition	2 toilets available, 1 for boys and 1 for girls. Works in prograss for CWSN toilet.	Mid-day-meal is being provided, RCC kitchen good condition, store room OK. Place for serving meal OK.	Yes, very small playground. Land to be identify	Yes there is compound wall and in good condition.	Drinking water being supplied through Tap & tank. R.O. Plant available but not installed. Clean drinking water. The storage tank placed properly.		

Sufficient fans & lights available in all the class room all in good condition		Sufficient green board	Sufficient desks & benches available in all the classrooms average quality. 2 teacher chairs & table bad condition.	No separate Lab.	No computer lab.	Sport equipment available. But no sports room and no PET teacher		1 Head Master regular, 2 constractical teachers.		
Sufficient fans & lights available in all the class room all in good condition	No CCTV installed	Sufficient green board	Sufficient desks & benches available in all the classrooms average quality. 2 teacher chairs & table bad condition.	No science lab.		Sport equipment available. But no sports room and no PET teacher	Yes, the school road is connected with black top road. No tobacco selling shop and no Bar or Liquior shop near school premises.	1 Head Master regular, 2 constractical teachers.	During the inspection it was told by children that one boil egg three days a week us being served to them most of the children take egg and they like it very much. A fe children who do not take egg are being provided banana additionally.	Toilet to be repaired & teacher required.

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Primary School, Dalwada, Nani Daman.

Inspected by : Madhu K. Garg, Secretary(Social Welfare)

Civil works

Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013	No Major/Minor repair required in school building & roof. 6 class rooms for 1st to 5th std., Adl. Cupboard may be provided for office use	No	Yes	All doors are not condition	Around 4 windows is broken/damage condition	2 toilet available	Yes mid day meal being provided. Kitchen available, but no store room available. Material stored in class room. Standard quality meal provided. Utensils available. Store room not good. Clean & hygienic place for	No playground available for children for sport activities. No approx area available as space scarcity is not possible	Yes there is compound wall	R.O. plant installed, but installed in class room which need to be shifted in a separate room for safety. Drinking water is being supplied through tap. The storage tank is place properly.	
	Action not yet taken by concerned dept. on observation to earlier inspection Report	Yet cupboard is not provided	Not required	Not required	Not required	All 4 windows are now repaired	The construction of toilet the work is under progress. CWSN toilet not required.	Kitchen & store room is now separated, changes are made in the store room	Due to scarcity of land		No action taken to shift the R.O. plant in separate room. Children were directly drinking water from bore well storage tank. The RO plant is not required.	No action taken for providing separate staff room for teachers.
	Observations on the basis of latest inspection	Same condition persist				Yes	2 toilets available. No separate toilet for girls. The toilet found clean	Status of kitchen is being improved.	No changes made.	Yes there is compound wall	Presently the RO plant is not working.	Separate room is required for drinking water facility as it is stored in class room.
II	Name of School : Government Primary School,Dalwada, Nani Daman.											

Data as per Inspection of July, 2013	No Major/Minor repair required in school building & roof. 6 class rooms for 1st to 5th std., Addl. Cupboard may be provided for office use	No	Yes	All doors are not condition	Around 4 windows is broken/damage condition	2 toilet available	Yes mid day meal being provided. Kitchen available, but no store room available. Material stored in class room. Standard quality meal provided. Utensils available. Store room not good. Clean & hygenic place for serving MDM.	No playground available for children for sport activities. No approx area available as space scarcity is not possible	Yes there is compound wall	R.O. plant installed, but installed in class room which need to be shifted in a separate room for safety. Drinking water is being supplied through tap. The storage tank is place properly.	
Action not yet taken by concerned dept. on obervation to earlier inspection Report	Yet cupboard is not provided	Not required	Not required	Not required	All 4 windows are now repaired	The construction of toilet the work is under progress. CWSN toilet not required.	Kitchen & store room is now separated, changes are made in the store room	Due to scarcity of land		No action taken to shift the R.O. plant in separate room. Children were directly drinking water from bore well storage tank. The RO plant is not required.	No action taken for providing separate staff room for teachers.
Observations on the basis of latest inspection	Same condition persist				Yes	2 toilets available. No separate toilet for girls. The toilet found clean	Status of kitchen is being improved.	No changes made.	Yes there is compound wall	Presently the RO plant is not working.	Separate room is required for drinking water facility as it is stored in class room.

Adequate fans & lights are provided in all the class rooms all in good condition.	CCTV not installed. Smart class not implemented.	There are sufficient black board all are fitted in the centre	Add. Desk & benches required due to more students. 6 class rooms for 1st to 5th std. Addl. Cupboard may be provided for office use	No laboratory available. Equipment in sufficient quantity		Equipment in sufficient quality		1 H.M., 3 teachers, 260 students (138 boys & 122 girls). 4 regular post of teachers.		
Not required			No action taken for providing addl. Furniture.	No action taken		No play ground available				
All light and fans are in working condition	CCTV not installed. Smart class not implemented.	There are sufficient black board all are fitted in the centre	No changes made. Same condition persist.	Same condition persist.			Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquor shopu is available in near by permises.	1 H.M., 3 teachers, 260 students (138 boys & 122 girls). 4 regular post of teachers.		

III.	Name of School : Government Primary School, Kathiriya, Nani Daman.											
	Data as per Inspection of July, 2013	4th floors building. Only tow floors being used by GPS & GMS. Building on rental basis, flooring in class room in damage condition. 5 class rooms for 1st to 5th Std. 2 rooms not in use due to leakage from toilet. If leakage from toilet is stopped. These rooms can be used for serving meals	White wash required	CWSN ramp available.	Yes, all doors in good condition	Some window in broken condition	Separate toilets for boys & girls available but in badly leakage condition. No CWSN toilet and it is not required	MDM being supplied. Combined kitchen available with GMS. No separate room to serve meal is available. Separate room needs to be provided. Utensils available. Store room not good.	Playground not available. In front of the school with cement concrete base.	School is having compound wall	R.O. plant installed, but in open condition therefore required frequent repairing. It is to be covered for safety. Bigger size water tank needs to be installed. No storage tank is not place properly.	No separate staff room available its included in office room
	Action not yet taken by concerned dept. on observation to earlier inspection Report	Same condition persist no action taken. Roof O.K.	Same condition persist no action taken.	Not required	Not required	repaired	No action taken	No action taken for separate kitchen, Yes changes are made in store room	No action taken	Not required	R.O. plant presently its not working properly. Water is supplied through water tank but no proper maintenance is done. No action has taken to place properly the storage tank	No action taken
	Observations on the basis of latest inspection			Yes	Yes	No changes required.	No changes	No changes made in kitchen. Store room in good condition		Front gate need to be repaired as children of localities enters the school when school is enclosed.		No changes made. No separate staff room available, therefore adjusted in office-cum-staff room.
IV	Name of School : Government Middle School, Kathiriya, Nani Daman.											
	Data as per Inspection of July, 2013	4 floors building. Only two floors being used. Building on rental basis, flooring in class room in damage condition, Rest 2 floor are used for Bed college. 4 class rooms. Std 6A, 6B, 7, 8A & 8B being used. 1 - 5 Primary - in the afternoon shift.	Building need white wash	Yes	All doors in good condition	Some window in broken condition	Separate toilets for boys & girls available but in badly leakage condition. No CWSN toilet and it is not required	Yes mid day meal being provided. Comnined kitcehn available with GMS. No separate room to serve meal is available. Separate room needs to be provided. Very old utensils are used. Store room not good. Clean place for serving MDM.	Not available as compound is of concrete cement.	Yes there is compound wall	R.O. Plant installed but in open condition therefore required frequent repairing. It is to be covered for safety. In bad shape. The water is being stored in storage tank. R.O. plant available. Storage tank not place properly.	

All light and fans are in working condition	CCTV not installed. Smart class not implemented.	Black Board is O.K.	Desk and benches are of very high/big size and not comfortable for Primary students. Small size desk and benches to be provided	391 books available required more	1 touch screen computer, but not in working condition. This provided only for 1st class students.	Sports equipment is sufficient in quantity.		5 teachers, 134 students (67 boys & 67 girls)	School building is in a low lying area and flood water hampers proper functioning of school. Main gate requires to be uplifted by about 2.5 feet to stop flood water from entering the school	
No changes made. Overall wiring changes required as its too old.	Not implemented		No action taken	No action taken.	No action taken					
Need more fans in classrooms	Not implemented	Sufficient black/white boards are available.	No changes made.	Changes made	Computer not working since last two years.	No new equipment are issued after breakage.	Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquor shopu is available in nearby premises	1 H.M., 5 teachers, 116 students (63 boys & 63 girls). 4 regular teacher & 1 contractual.	Gutter blockage problem.	shed in the compound for children as they can have meal over there.
All light and fans are in working condition	CCTV not installed. Smart class not implemented.	Black Board is O.K.	Benches very old, needs repairs and replacement	695 books available. Library combined with science Lab.	10 computers with UPS all in working condition	Equipment in sufficient quality		2 regular, 2 SSA & 3 part time teachers in different time (1 science teacher promoted & transferred, therefore additional science teacher needed) 119 students (59 boys 60 girls).		

	Action not yet taken by concerned dept. on observation to earlier inspection Report	No action taken for 4 floor building. No action taken for construction of separate class rooms for Primary section	No action taken	Not required	Not required	repaired	No action taken for leakage in toilet. Toilet was stinking badly so it seem not cleaning	No action taken for separate kitchen, Yes changes are made in store room	No changes made.		No action taken for R.O. Plant. Tank size is of very small need to place bigger one. No proper	
	Observations on the basis of latest inspection	Same condition persist.	Same condition persist.	Yes	Yes	No changes required.	No changes	Store in good conditon	Same condition persist.	Yes there is compound wall	R.O. plant presently its not working properly.	No separate staff room available its included in office room

No changes made. Overall wiring changes required as its too old.	Not implemented		No action taken	No action taken	Not required	No new equipment are issued after breakage.				
Need more fans in classrooms	Not implemented	Sufficient black/white boards are available.	No changes made.	N.A.	All are in good condition		Yes, the school road is connected with black top road. Notice for not selling tobacco near school premises should be given. There are some Bar and Liquior shop found within 100 mts of school premises.	1 H. M., 6 teachers, 106 students, 106 students (47 boys & 59 girls). 3 regular, 1 contractual and 2 under SSA teacher.		

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Primary School, Ashram Bhimpore(Afternoon).

Inspected by : Seema Bawa, Dy. Secretary(Dev.)

Civil works

Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013	1 building in good condition, Roof require minor repair, 5 Nos. of class room			Yes	Yes	Yes	Yes	Levelling is required in play ground	Yes, boundary wall is broken & required repair.	Yes	
	Action not yet taken by concerned dept. on observation to earlier inspection Report								Not done	Not done		
	Observations on the basis of latest inspection	1 building in good condition, Roof require minor repair, 5 Nos. of class room available	Building need white wash.	Ramps are available in 2 Nos but side handrail to be fixed.	Yes all doors in good condition	All windows are not in good condition. 4 Nos of windows needs repair/replacement	One toilet is for boys & one for girls and separate toilet block also available for girls. The toilet found clean. As informed by the School Authority the toilet CWSN to be provided shortly by the District Panchayat.	Yes Mid Day Meal has been provided. RCC kitchen but small exists. Separate Kitchen is required. Utensils available. Storage available but very far from the kitchen. New store room adjoining the kitchen is required for convenience for cooking of food. Clean place for serving MDM.	Work still pending requires of levelling of play ground for better sports activities.	Work still pending. The height of the boundary wall also needs to be increased.	Drinking water is supplied through bore wall. RO plant is available. The water tank is being cleaned twice a year. The storage tank is being placed properly. Need special room for drinking water.	New water supply pipeline is required for safe drinking water as the old one has become rusty and are non-hygienic.
II	Name of School : Government Middle School, Ashram Bhimpore(morning).											

	Data as per Inspection of July, 2013	1 building in good condition, roof require minor repair			Yes	Yes	Yes	Yes	Levelling is required in play ground	Yes, the school is having compound wall. Boundary wall is broken & required repair		
	Action not yet taken by concerned dept. on observation to earlier inspection Report								Not done	Not done		
	Observations on the basis of latest inspection	1 building available in good condition, roof required minor repair. Separate staff room required, 3 Nos of class room available. Two rooms required for tailoring & computer. One room required for Libarary.	Yes	Yes, 2 nos of building having ramp but side railing to be fixed	Yes	Not all the windows in good condition. 4 Nos of windows need repair/replacement	One toilet is for boys & one for girls and separate toilet block also available or girls. The toilet found clean. As informed by the School Authority the toilet CWSN to be provided shortly by the District Panchayat.	Yes Mid Day Meal has been provided. RCC kitchen but small exists. Separate Kitchen is required. Utensils available. Storage available but very far from the kitchen. New store room adjoining the kitchen is required for converience for cooking of food. Clean place for serving MDM.	Work still pending requires of levelling of play ground for better sports activities.	Work still pending. The height of the boundary wall also needs to be increased.	Drinking water is supplied through bore wall. RO plant is available. The water tank is being cleaning twice a year. The storage tank is being placed properly.	New water supply pipeline is required for safe drinking water as the old one has become rusty and are non-hygienic.

2 more fans required in all classrooms		Yes	Available			Available		4 Regular Teachers		
Fans are repaired but not in good working condition as the speed is very slow.										
New 14 nos of fans are required by replacing of old fans. All fans are very slow running. Sufficient lights are available. All in working condition. 2 nos of lights are required in school compound.		Yes	Sufficient Desks & benches are available. 7 tables are partly broken and needs to repaired. 2 nos of chair fo H. M. room & 5 nos. of more chairs for visitors are required. 7 tables are repairable.	No		New sports kit required for sports activity . Store room not available. PET teachernot available.	Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquor shopu is available in near by permises.	4 Regular Teachers, 1 contractual, 1 Under SSA & 1 Freeship teacher	There is leakage problem at many places in roof in rainy season. Manglore tiled roof is available, which needs to repair for good functioning of class rooms.	1-Xerox machine is required for office use as requested by Headmaster.

III.	Name of School : Government Primary School, Nani Daman (G/M)(Morning).											
	Data as per Inspection of July, 2013	1 building in good condition, Roof require minor repair, 5 Nos. of class room			Yes	Yes	Yes	Yes	Levelling is required in play ground		Yes	
	Action not yet taken by concerned dept. on observation to earlier inspection Report								Not done	Not done		
	Observations on the basis of latest inspection	1 building in good condition, Roof require minor repair, 5 Nos. of class room available	Building need white wash.	Ramps are available in 2 Nos but side handrail to be fixed.	Yes all doors in good condition	All windows are not in good condition. 4 Nos of windows needs repair/replacement	One toilet is for boys & one for girls and separate toilet block also available or girls. The toilet found clean. As informed by the School Authority the toilet CWSN to be provided shortly by the District Panchayat.	Yes Mid Day Meal has been provided. RCC kitchen but small exists. Separate Kitchen is required. Utensils available. Storage available but very far from the kitchen. New store room adjoining the kitchen is required for convenience for cooking of food. Clean place for serving MDM.	Work still pending requires of levelling of play ground for better sports activities.	Work still pending. The height of the boundary wall also needs to be increased.	Drinking water is supplied through bore wall. RO plant is available. The water tank is being cleaning twice a year. The storage tankl is being placed properly. Need special room for drinking water.	New water supply pipeline is required for safe drinking water as the old one has become rusty and are non-hygienic.
IV	Name of School : Government Middle School, A/s, Bhimpore, Nani Daman.											
	Data as per Inspection of July, 2013	1 building in good condition, roof require minor repair			Yes	Yes	Yes	Yes	Levelling is required in play ground	Yes, the school is having compound wall. Boundary wall is broken & required repair		
	Action not yet taken by concerned dept. on observation to earlier inspection Report								Not done	Not done		

	<p>Observations on the basis of latest inspection</p>	<p>1 building available in good condition, roof required minor repair. Separate staff room required, 3 Nos of class room available. Two rooms required for tailoring & computer. One room required for Libarary.</p>	<p>Yes</p>	<p>Yes, 2 nos of building having ramp but side railing to be fixed</p>	<p>Yes</p>	<p>Not all the windows in good condition. 4 Nos of windows need repair/replacement</p>	<p>One toilet is for boys & one for girls and separate toilet block also available or girls. The toilet found clean. As informed by the School Authority the toilet CWSN to be provided shortly by the District Panchayat.</p>	<p>Yes Mid Day Meal has been provided. RCC kitchen but small exists. Separate Kitchen is required. Utensils available. Storage available but very far from the kitchen. New store room adjoining the kitchen is required for converience for cooking of food. Clean place for serving MDM.</p>	<p>Work still pending requires of levelling of play ground for better sports activities.</p>	<p>Work still pending. The height of the boundary wall also needs to be increased.</p>	<p>Drinking water is supplied through bore wall. RO plant is available. The water tank is being cleaning twice a year. The storage tank is being placed properly.</p>	<p>New water supply pipeline is required for safe drinking water as the old one has become rusty and are non-hygienic.</p>
--	---	--	------------	--	------------	--	--	--	--	--	---	--

<p>New 14 nos of fans are required by replacing of old fans. All fans are very slow running. Sufficient lights are available. All in working condition. 2 nos of lights are required in school compound.</p>		<p>Yes</p>	<p>Sufficient Desks & benches are available. 7 tables are partly broken and needs to repaired. 2 nos of chair fo H. M. room & 5 nos. of more chairs for visitors are required. 7 tables are repairable.</p>	<p>No</p>	<p>11 Nos. of computers exists but requires repairs. Four computers working.</p>	<p>New sports kit required for sports activity . Store room not available. PET teachernot available.</p>	<p>Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquor shopu is available in near by permises.</p>	<p>4 Regular Teachers, 1 contractual, 1 Under SSA & 1 Freship teacher. 1 Science Teacher + 1 English teacher required</p>	<p>There is leakage problem at many places in roof in rainy season. Manglore tiled roof is available, which needs to repair for good functioning of class rooms.</p>	<p>1-Xerox machine is required for office use as requested by Headmaster.</p>
--	--	------------	---	-----------	--	--	---	---	--	---

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Primary School, Bhenslore, Nani Daman.

Inspected by : Gaurav Singh Rajawat, IAS, Dy. Collector(HQ)

Civil works												
Sr.No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hyginic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013			Yes, but - 30°	yes	No						
	Action not yet taken by concerned dept. on obervation to earlier inspection Report											
	Observations on the basis of latest inspection	3 new class room, Roof tiles change, 3 not cleaned, storeroom type	Yes,full building		yes	No, All	Common toilet, toilet is not clean. No separate toilet for girls, No CWSN toilet.	Yes, for kitchen there is temporary shed, utensils are available, No store room, Place for serving mid-day-meal is ok.	No plauground and also no land available approx area.	No compound wall	Water is supplied through Tap. There is RO plant available. The Tap/storage tank is ok. RO to be repaired.	
II	Name of School : Government Middle School, Bhenslore, Nani Daman.											
	Data as per Inspection of July, 2013											
	Action not yet taken by concerned dept. on obervation to earlier inspection Report											
	Observations on the basis of latest inspection	Need three new class room, Roof & tiles need to be changed, 3 store room type is not cleaned.	Yes, full building need to be white wash	yes	yes	All window panes needs to be repaired	There is common toilet, no separate toilet for girls and not proper cleaned and there is no CWSN toilet facility.	yes, for kitchen there is temporary shed, utensils are available, No store room, Place for serving mid-day-meal is ok.	No plauground and also no land available approx area.	No compound wall	Water is supplied through Tap. There is RO plant available. The Tap/storage tank is ok. RO to be repaired.	
III.	Name of School : Government Primary School, Devka Colony, Nani Daman.											

	Data as per Inspection of July, 2013											
	Action not yet taken by concerned dept. on observation to earlier inspection Report							No Store room				
	Observations on the basis of latest inspection	School building, roof and class are ok	—	Not necessary	good	good	Cleaness OK. No separate toilets for girls. No CWSN toilet.	Mid-day-meal is being provided, RCC kitchen, place for serving meal OK.	No playground and also no land available approx area.	Yes there is compound wall	Water is supplied through Tap. There is RO plant available. The Tap/storage tank is placed properly.	
IV	Name of School : Government Primary School, Devka Taiwad, Nani Daman.											
	Data as per Inspection of July, 2013											
	Action not yet taken by concerned dept. on observation to earlier inspection Report											
	Observations on the basis of latest inspection	School Building, Roof, class rooms in good condition.	Not required	Not required	Good condition	Good condition	two toilets available, 1 functional. Girls toilet is unhygienic condition. No CWSN toilet	Mid-day-meal is being provided 6 days, RCC kitchen, store room OK. Place for serving meal OK.	No playground but 1800 sq. mts land available approx area.	No compound wall	Status of drinking water is very poor. RO plant not in working condition. The Tap/storage tank is placed properly.	

Sufficient fans available in the classroom. All fans and lights in working condition. Over all observation on lighting of school compound is OK.	CCTV not installed.	Black boards are there and all black board are in the centre	There are sufficient desk and benches all in good condition.	No Science Lab.	9 computers	Yes, sport facility is available. No separate room for sport equipment. There is PET Teacher.	Yes, the school road is connected with black top road. No tabacco selling shop and no Bar or Liquior shop near school premises.	4 teacher is available, 2 regular , 1 contractual, 1 under SSA.		
Sufficient fans available in the classroom. All fans and lights in working condition. Over all observation on lighting of school compound is OK.	No CCTV installed	Black board not of good quality. All the board are in the centre		No science lab.		Yes, sport facility is available. No separate room for sport equipment. There is PET Teacher.	Yes, the school road is connected with black top road. No tabacco selling shop and no Bar or Liquior shop near school premises.	3 regular , 1 under SSA.		

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government Primary(E/M), Nani Daman(Std.1st & 3rd) Paryatan Bhavan), Nani Daman.

Inspected by :P.S. Reddy, Finance Secretary, DD&DNH.

Civil works												
Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
I	Data as per Inspection of July, 2013	Building found satisfactory. Roof asbestos, leakage in corner room (need repairs). Wooden portion of class rooms need repairs/replacement	06 nos class room require painting				Existing not sufficient	Existing in the premises, Kitchen RCC, Utensils available. Store room yes and clean place for serving Mid day meal.	Exisitng DMC playground	Compound wall yes and in good condition.		
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	Action taken					Not provided exta toilets. Work order is issued for CWSN toilet					
	Observations on the basis of latest inspection	Satisfactory. Require 25 class rooms	Yes	Ramps are available for CWSN	All the doors are not in good condition. 5 doors requires repairs	All the window are not in good condition. 6 windows requeres repairs	Need more toilets. The toilet is clean. There is girls toilet separate but not sufficient	Mid-day Meal -yes, RCC Kitchen - yes, Store room yes and in good conditin	No playground and also no land available approx area.	Compound wall yes and in good condition.	Drinking water is supplied through tap. RO plant is available but not working. Cleaning is being done monthly. Storage tank is placed properly.	Need water proof
II	Name of School : Government Primary School(E/M), Nani Daman(Std. 5th) (SVD).											

All the fans and lights are in working condition. 17 light and 12 tube light are in working condition.	CCTV is being installed and is in working condition. No smart class and no teacher	There are sufficient black board all fitted in the centre.	Sufficient Desk and benches are available in all the class rooms	Not available	Not available	No sport facility is available and no PET teacher.	Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquor shopu is available in near by permises.			
								12 teachers are available. 4 regular, 4 contractual, 2-under SSA, 2 freeship teacher.		This building is handed by SVD Nani Daman.

III.	Name of School : Government Primary School(E/M), Nani Daman(Std. 2nd and 4th) (Community Hall).											
Data as per Inspection of July, 2013	School building, roof and class room are found satisfactory.Wooden portion of class rooms need reparis/replacement											
Action not yet taken by concerned dept. on obervation to earlier inspection Report	Action taken											
Observations on the basis of latest inspection	School building, roof and class room are found satisfactory.Wooden portion of class rooms need reparis/replacement	Requires white wash.	School is having Ramp for CWSN	All doors in good condition	All windows in good condition. 6 requires replacement.	Sufficient toilets are available. Toilets are being cleaned regularly. Separate toilets for grils are avaiable. Toilets for disable friendly is not available.	Mid-Day Meal is being supplied every day. Kitchen Good condition, Store room in good conditin. Cleaned placed for serving Mid-Day Meal.	There is play ground	There is compound wall	Drinking water is supplied through tap. RO plant is not available. The water tank is being cleaning monthly. Storage tank is required as it is very old.	R.O. Plant and good storage tank is required.	
IV	Name of School : Government Primary School, Magarwada, Moti Daman.											
Data as per Inspection of July, 2013	School building O.K, Roof O.K. Class room good condition	yes		yes	yes	There is toilet facilities found cleand. Separate toilet for girls and not CESN toilet.	Yes	No play ground and no approx area for playground.	Compount wall available.	Drinking water is being supplied through Borewell. R.O. available		
Action not yet taken by concerned dept. on obervation to earlier inspection Report		yes										
Observations on the basis of latest inspection	Tarace leakage, required water proofing on terace.	Toilet and bathroom need white wash	Yes the school is having ramp for CWSN.	yes	yes		Good Mid-day meal is being supplied. RCC kitchen. Utensils available, Store room available and clean place for serving mid day meal.		Compount wall available and in good condition.	Borewell is not working. Need PWD water connection. R.O. Plant not working. No water supply. Tap/storage tank is placed properly.	Need water proof.	

There are 17 fans all in working condition and 10 lights all in working condition		Black Board/White Board is O.K.				Sport facility is available but no Sport room is and no PET teacher.		9 teachers are available, 6 regular, 3 under SSA		
			Action taken							
There are adequate fans and lights available all in working condition.	No CCTV installed and also no Smart class provided.	Sufficient black boards/white board are available all in the centre.	50 desk and benches and 6 tables. 30 benches are broken and 50 benches are repairable.	No science Lab.	No computer lab. Room		No the school road is not connected with black top road. There is no selling of tobacco near school premises nor any Bar and Liquor shop found within 100 mts school premises.	9 teachers are available, 6 regular, 3 under SSA. PET, drawing, English and Musich teacher is required.	The school is runnding in Community Hall, New DMC building. It is surrounded by hawkers making approach difficult. Needs to be shifted to proper premises.	
Yes		O.K.	Sufficent desk and benches are available	No Science Lab.						
Adequate fans and lights are available. Two fans need repair and five tube lights need repair.	N.A.	Sufficient black/white board is available. All in the centre.	Sufficent desk and benches are available	N.A.	One computer in working condition.	Sport facilities available no sports room required and PET teacher required.	Yes the school is connected with the black top road. No tobacco shop and no Bar and Liquor shops is avabile within the 100mts of school premises.	Two regular teacher and two freeship teacher.	The borewell need repairs	New water connection is required. R.O. Plant needs to be supplied.

SCHOOL INSPECTION REPORTS BY OFFICERS (MARCH, 2014)

Name of School : Government High Secondary School, Moti Daman.

Inspected by : S.K. Varma, Dy. Secretary(Per.)

Civil works

Sr. No.	Items	Major/Minor repairs of Buildings, Roof & Class Rooms (Under Civil Works)	Requirement of white wash & painting.	CWSN enabled Ramp with 15° to 20° slope.	Condition of all doors	Condition of all windows & windows Panes	Number of Toilets available & Functional, cleanliness, separate toilet for girls & CWSN friendly;	Daily Mid-Day Meal, Status of Kitchen (RCC/Katcha/class room) Utensils, Store room clean & hygienic food, service & place of eating	Playground availability & if not, land availability nearby.	Availability of compound wall & condition	Supply of clean drinking water/Tap water/Borewell/Storage Tank. R.O. plant & cleanliness	Any other remarks about Civil works need to be carried out
1	2	3	4	5	6	7	8	9	10	11	12	13
1	Data as per Inspection of July, 2013	White wash is under process. Windows need to be repaired Electrical wiring is dangling require repair. Classroom OK.	O.K.	Yes	All doors are not condition	Windows need to be repaired	Toilet is there but wash basin is without taps and outlet. Not clean. Dirty water from toilet splitting into the passage. There is separat toilet for girls and no CWSN toilet	N.A. since Std. 9th to 12th Std.	Common playground for GPS & GHSS the open space/playground is covered with paver blocks	O.K.	Water is supplied through Tap & Bore well. R.O. plant is available. The water tank is being cleaning monthly. The Tap/storage tank is placed properly.	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	Action taken				not repaired	Partly action taken			N.A.		

Electric works	CCTV & Smart Class	Infrastructure				Sports Facility	Approach to the schoc Teachers			
No. of Fans/Lights & condition of overall lighting facility	CCTVs & working condition. Function & utilisation of Smart Classrooms. Type of teaching aids/mass media utilised by Teachers.	Availability and Visibility of Black/White Boards in the class rooms.	Availability of Desks/benches/tables & cupboards in the class-room & Staff room. Requirement and Repairables	Status & condition of Science Lab. and availability of equipments & materials.	Status & condition of Computer Room, ACs & computers(installed and in working condition).	Availability of sports facilities, sports room & PE Teacher	Is the school connected with black top road, if not is the approach proper? Is there tobacco selling shop/Bar & Liquor shop within 100 mts of school premises.	No. Of posts & Teachers available. Regular Contractual/Daily wages/ SSA/ Freeship teacher/ Part time. Requirement of specific subject teacher, if any.	Any other relevant observation	General Remarks
14	15	16	17	18	19	20	21	22	23	24
Yes 08 fans were not working. Regulator of fans missing. Adequate light is available 87 are in working condition.	There is CCTV. No smat class		Some benches need to be repair. More benches are required	Lab. Attendent is posted with Secretaruy(Edu.)	Dirty and computer moniter CPU found uncovered. Arrangements are not proper. AC is not installed. Ceiling is leaking. No. computer instructor is posted. 17 computer are installed all in working condition.	Sport facility is available, Sport room is available and also PET teacher is there to care of sports		18 teachers and 659 students	At present in the same school building Primary Middle and Secondary with Higher Secondary is running. Over all it is observed that numbers of class rooms are not adequate to run school smoothly with all sections i.e. from Primary to Higher Secondary. At least Ten more class rooms are required and Aditarium and Science Lab. and large sports room is required to be constructed. Therefore, it is suggested to survey the school premises and to check the possibility to reconstruct the school building with G+2. in L shape.	
Action taken			Action taken	No action taken	complete lab. Maintainance					

	Observations on the basis of latest inspection	White wash is completed. One auditorium and one science Lab. And Ten more class are required to be constructed. Some of the roof tiles is broken. Ten class room are required.	White wash is completed	ramps are available at Ground floor only	One door is required to be replaced	15 window panes are not in good condition to be replaced	Toilet need complete repair. Wash basin to be installed. CWSN disabled friendly toilets required to be constructed.	Schem is applicable for Primary and Middle School only.	The open space is about 200sq. Mt. it is not like a playground, yes 4000 Sq. Mts. Land is available nearby. Land is Private property can be acquired for good play ground.	Height of compound wall should be increased at North side.	One more storage tank is required to be built.	Separate room is required for drinking water storegae & supply. It has been suggested that new school building in "L" shap may be constructed after demolation of old building which is located in side with rood of cement sheet.
II	Name of School : Government Primary School, Moti Daman.											
	Data as per Inspection of July, 2013	White wash is under process. Windows need to be repaired Electrical wiring is dangling require repair. Classroom dirty and carbage found lying near classroom.	White wash is completed	Ramps are CWSN yes	All the doors are not in good condition. 1 door need to be replaced.	No, all the window are not in good condition	Toilets is in bad shape requires complete renovation. They are very dirty and stinking badly. There is separate girls toilet. But no CWSN toilet	Mid-Day Meal is being supplied every day. Cleaned placed for serving Mid-Day Meal.	Common playground for GPS & GHSS the open space/playground is covered with paver blocks	Yes, the school is having compound wall and is O.K.	RO plant is installed and is in working condition. Water is being supplied through Tap & Bore well. The water tank is being cleaned Bi monthly. The tank is place properly.	
	Action not yet taken by concerned dept. on obervation to earlier inspection Report	Action taken	Action taken				Partly action taken	No Store room		N.A.		
	Observations on the basis of latest inspection	Some roof tiles found is broken	White wash is completed.	Ramps are available at Ground floor only	Three door are to be replaced.	15 window panes are not in good condition to be replaced	It has been stopped the dirty water from toilet but wash basin has to install	Kitchen shed is available	The open space is about 200sq. Mt. it is not like a playground, yes 4000 Sq. Mts. Land is s Private property can be acquired.	Height of compound wall should be increased at North side.	Separate room is required for drinking watet storage & supply.	It has been suggested that new school building in 'L' shape may be construc ted after demolation of old building which is located in side with roof of cement sheet.

All light and fans are in workin condition	No smart class. Smart classes is required to be constructed with equipment with instructor/teacher	There are sufficient black board all are fitted in the centre	Sufficent benches are available.	Science Lab. In good condition. But large size of science laboratory is required. Lab. Technician is required for the school.	Computer Lab. Required proper maintainans and computer teacher has been posted or three days per week. Require full time computer teacher. Acs are in working condition.	Sports rooms is too small. Large sport room is require to be constructed.	Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquior shopu is available in near by permises.	Regular teacher 22, contractual teacher 6		
All the fans and lights are in working condition. 87 light are in working condition.	CCTV is being installed. No smart class	There are sufficient black board all fitted in the centre.	Table and benches are broken and required repairs	It is not equipped fully and the room is dirty and found stinking	No AC in working condition. No computer has been installed	Steel rack found staked. Unused materials like sport gear/dress found lying. Garden machine placed there. No PET teacher	Yes, the school road is connected with black top road. The road is OK. No tobacco selling shop and no Bar liquior shopu is available in near by permises.			
			Action taken							
The over allobservation on lighting in school compound is good.	Yes the control is under High school. Smart class is required.		Yes	No	Require AC and 10 computers are required.	Require sport room with equipment and PET teacher		1- Head Master, 5 regular teacher, 1 under SSA.	At present in the same school building Primary Middle and Secondary with Higher Secondary is running. Over all it is observed that numbers of class rooms are not adequate to run school smoothly with all sections i.e. from Primary to Higher Secondary. Therefore is is suggested to suvey the school premises and to check the possibility to reconstruct the school building with G+2 in L shape.	

III.	Name of School : Government High Secondary School, Dabhel, Nani Daman.											
	Data as per Inspection of July, 2013	Boundary wall is to be repaired	White wash required	A ramp can be constructed inside school	Door is to be repaired		2 toilets & 4 bath rooms is required upgradation	No	Playground is same of GPS & GHSS flooring is with cement flooring	Boundary wall is to be repaired	Water fitting is proper it is badly designed and required to be refitted	It has been suggested that new school building in 'L' shape may be constructed after demolation of old building which is located in side with roof of cement sheet.
	Action not yet taken by concerned dept. on observation to earlier inspection Report	Action taken	Action taken	Action taken	Some door repaired, temporary repaired. Not replaced but repaired	Partly action taken. The windows has been temporary repaired not replaced			Action taken	Action taken	Action taken	

Electric wiring is dangling and requires repair		Black Board is O.K.	New benches are required in two class rooms and also desks are required	It is used as store room cum library cum laboratory. Also use to store unused computers. Used as store room with old instruments. Old computers are stored library is also there.	Net work existing. No computer lab teachers are there. Computer room requires white wash. AC switch is not working air condition has no outlet for water discharge.	Keys were with PT teacher. Inspection could not be done.		129 students (HSC) & 0 teachers	School building is in a low lying area and flood water hampers proper functioning of school. Main gate requires to be uplifted by about 2.5 feet to stop flood water from entering the school	
Action taken			Action taken	Action taken	Action taken	Action taken		Action not taken		

	<p>Observations on the basis of latest inspection</p>	<p>Pillars of building are cracked, it is necessary to examine by structural engineer for safety it seems to reconstruct the building after demolition and should construct about 44 nos of class rooms for better functioning of school for Primary, Middle and Sec./Higher Sec. sections. Need to be demolished required more class rooms</p>	<p>White wash completed</p>	<p>ramp made properly as per norms.</p>	<p>4 doors have to be repaired and 4 doors have to be replaced.</p>	<p>10 windows panes need to be repaired, 16 windows need to be replaced.</p>	<p>Toilets are being cleaned regularly. Separate toilets for girls are available but more toilets with toilet blocks should be provided at time of reconstruction. Toilets for disabled friendly is not available.</p>	<p>Mid-day-meal is being provided, Katcha kitchen, Utensils are available. store room shifted in temporary M.S. shed room. Place for serving meal yes.</p>	<p>The little open space is being used as playground but it is not sufficient space if existing buildings are demolished and well planned structure with longer ground is made. Constructed sufficient space can be available.</p>	<p>Wire fencing is needed on top of the boundary wall.</p>	<p>Tap & bore well larger R.O. plant is required as per strength of students. The water tank is being cleaned quarterly. New pipe lines are to be replaced. New water storage tank and need special room for drinking water/cooler</p>	<p>Required new building as mentioned at col.1</p>
--	---	---	-----------------------------	---	---	--	--	--	--	--	--	--

<p>6 new fans are provided 40 fans are in working condition but still more fans need in the school. Adequates light is provided. Flood light is required in the compound</p>	<p>CCTV installed under the control of High School, Smart class to be provided with equipments and instructor.</p>	<p>Sufficient black boards are available. It is not possible to fit in the centre of the six rooms as it is made in load baring design. 6 black board is required to fit in the centre.</p>	<p>Benches are supplied. Some benches are to be repaired, 40 benches are broken and 40 benches repairable.</p>	<p>N.A.</p>	<p>Computer lab yes. AC requires. Computer requires.</p>	<p>Yes, sport facility is available. No separate room for sport equipment. There is no PET Teacher.</p>	<p>Yes, the school road is connected with black top road. Notice for not selling tobacco near school premises should be given. There are some Bar and Liquior shop found within 100 mts of school premises.</p>	<p>11 teachers, 1 HM, 6 Primary Teachers, 1 contractual, 3 under SSA. 3 Primary teachers is required</p>	<p>This school is located in the industrial area, day by day numbers of students are increasing tremendously therefore more and more class rooms are required. As mentioned in the col. 3 New building should be constructed in view of risky structure of the building safety and to avail sufficient i.e. 44 class rooms. School building is in low lying area and flood water hampers proper functioning of school. Main gate requires to be raised by about 2.5 feet to stop flood water from entering the school.</p>	
--	--	---	--	-------------	--	---	---	--	--	--